

Area 6 - North Dorset

C13 - Dinah's Hollow - Melbury Abbas

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
1	chainage 80-90	1	1.00	Sycamore	ST82-8212-0349	10.0m	3.0m	32cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Regrown pollard or topped tree	Re-pollard	ESSENTIAL WORK
2	chainage 80-90	1	1.00	English Oak	ST82-8210-0354	16.0m	12.0m	45cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Co-dominant Stems	None recorded..	NO ACTION REQUIRED
3	chainage 90-100	1	1.00	Sycamore	ST82-8215-0353	9.0m	2.0m	24cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed	None recorded..	NO ACTION REQUIRED
4	chainage 90-100	1	1.00	Sycamore	ST82-8215-0355	11.0m	2.0m	24cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Suppressed	None recorded..	NO ACTION REQUIRED
5	chainage 90-100	1	1.00	Sycamore	ST82-8214-0360	16.0m	8.0m	34cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Regrown pollard or topped tree	Re-pollard	ESSENTIAL WORK
6	chainage 100-110	1	1.00	Sycamore	ST82-8217-0367	13.0m	6.0m	31cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed	None recorded..	NO ACTION REQUIRED
7	chainage 110-120	1	1.00	Holly	ST82-8221-0370	5.0m	3.0m	12cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed	None recorded..	NO ACTION REQUIRED
8	chainage 170-180	1	1.00	English Oak	ST82-8217-0372	15.0m	7.0m	33cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Regrown pollard or topped tree	None recorded..	NO ACTION REQUIRED
9	chainage 110-120	1	1.00	Sycamore	ST82-8220-0374	12.0m	5.0m	29cm	Semi-mature	Dying 25%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Coppice Derived-Multi-stemmed Basal rot/cavity SIGNIFICANT cavity-TRUNK > 50% stem	Re-coppice	ESSENTIAL WORK
10	chainage 120-130	1	1.00	Sycamore	ST82-8225-0381	11.0m	4.0m	28cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Lean > than 20% Regrown pollard or topped tree Raised roots/buttressing - roots exposed by soil erosion on bank Suppressed - tree growing at 45o angle out of bank	Re-coppice	ESSENTIAL WORK
11	chainage 120-130	1	1.00	Sycamore	ST82-8221-0384	14.0m	5.0m	32cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Lean > than 20% Regrown pollard or topped tree Suppressed	Re-pollard	ESSENTIAL WORK

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
12	chainage 120-130	1	1.00	Sycamore	ST82-8223-0391	17.0m	11.0m	42cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone Electric Cables overhead/nearby	Regrown pollard or topped tree Coppice Derived-Multi-stemmed - 6x sycamore stems with 1x ash stem growing over field	Re-pollard	ESSENTIAL WORK
13	chainage 130-140	1	1.00	Sycamore	ST82-8223-0395	5.0m	2.0m	13cm	Semi-mature	Dying 25%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Coppice Derived-Multi-stemmed Basal rot/cavity Stump	Fell to ground level	ESSENTIAL WORK
14	chainage 130-140	1	1.00	Holly	ST82-8226-0395	4.0m	3.0m	12cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed	None recorded..	NO ACTION REQUIRED
15	chainage 130-140	1	1.00	Sycamore	ST82-8226-0403	14.0m	9.0m	33cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone Electric Cables overhead/nearby	Multi-Stemmed Regrown pollard or topped tree	Re-pollard	ESSENTIAL WORK
16	chainage 130-140	1	1.00	Sycamore	ST82-8227-0408	16.0m	11.0m	42cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone Electric Cables overhead/nearby	Multi-Stemmed Tight Forks/Included Bark-MAIN FORK Cavities Decay - MAIN FORK(S) Ivy/climbers Restricting Inspection	Ivy band @ base Crown Reduction by - up to 3-4m	ESSENTIAL WORK
17	chainage 150-160	1	1.00	Hazel	ST82-8228-0416	4.0m	3.0m	20cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Coppice Derived-Multi-stemmed	None recorded..	NO ACTION REQUIRED
18	chainage 150-160	1	1.00	Hazel	ST82-8230-0417	4.0m	3.0m	20cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Coppice Derived-Multi-stemmed	None recorded..	NO ACTION REQUIRED
19	chainage 150-160	1	1.00	Sycamore	ST82-8230-0421	14.0m	10.0m	39cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Major limb loss/failure Multi-Stemmed Regrown pollard or topped tree Tight Forks/Included Bark-MAIN FORK Ivy/climbers Restricting Inspection	Ivy band @ base Re-pollard	ESSENTIAL WORK
20	chainage 160-170	1	1.00	Hazel	ST82-8231-0425	4.0m	3.0m	20cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Coppice Derived-Multi-stemmed	None recorded..	NO ACTION REQUIRED
21	chainage 160-170	1	1.00	Holly	ST82-8232-0428	4.0m	3.0m	12cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed	None recorded..	NO ACTION REQUIRED
23	chainage 130-140	1	1.00	Sycamore	ST82-8239-0434	7.0m	4.0m	12cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Raised roots/buttrressing - roots exposed due to soil erosion	Re-coppice	ESSENTIAL WORK

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
24	chainage 190-200	1	1.00	English Oak	ST82-8243-0453	16.0m	15.0m	84cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Major Deadwood - BRANCHES/STEMS	Remove major deadwood	ESSENTIAL WORK
25	chainage 200-210	1	1.00	Norway spruce	ST82-8250-0463	17.0m	9.0m	41cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Major Deadwood - BRANCHES/STEMS	Remove major deadwood	ESSENTIAL WORK
26	chainage 200-210	1	1.00	Sycamore	ST82-8252-0470	7.0m	4.0m	12cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Windblown/fallen tree - tree looks to have moved / fallen towards highway Single Stemmed Ivy/climbers Restricting Inspection Raised roots/buttressing - roots exposed due to soil erosion	Further inspection required	2 HRS EMERGENCY
22	chainage 170-180	1	1.00	English Oak	ST82-8236-0436	17.0m	12.0m	64cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Major Deadwood - BRANCHES/STEMS	Remove major deadwood	ESSENTIAL WORK
27	chainage 210-220	1	1.00	Sycamore	ST82-8249-0474	16.0m	12.0m	81cm	Mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Ivy/climbers Restricting Inspection Raised roots/buttressing - roots exposed due to soil erosion	Further inspection required Landowner to commission inspection Ivy band @ base	ESSENTIAL WORK
28	chainage 210-220	1	1.00	English Oak	ST82-8254-0476	13.0m	7.0m	62cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Ivy/climbers Restricting Inspection Raised roots/buttressing - roots exposed due to soil erosion Suppressed	Crown Reduction by - 3-4m	ESSENTIAL WORK
29	chainage 220-230	1	1.00	Hazel	ST82-8253-0480	4.0m	3.0m	20cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Coppice Derived-Multi-stemmed	None recorded..	NO ACTION REQUIRED
30	chainage 220-230	1	1.00	Sycamore	ST82-8253-0485	16.0m	12.0m	81cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Ivy/climbers Restricting Inspection Squirrel Damage MAJOR-BRNCHS/STEMS Raised roots/buttressing - roots exposed due to soil erosion Major cavity-TRUNK > than 20% stem	Fell to ground level	ESSENTIAL WORK
31	chainage 220-230	1	1.00	Hazel	ST82-8251-0486	4.0m	3.0m	20cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Coppice Derived-Multi-stemmed	None recorded..	NO ACTION REQUIRED
32	chainage 230-240	1	1.00	Hazel	ST82-8252-0493	4.0m	3.0m	20cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Coppice Derived-Multi-stemmed Ganoderma adspersum - BUTT	None recorded..	NO ACTION REQUIRED

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
33	chainage 230-240	1	1.00	Scot's pine	ST82-8265-0492	16.0m	10.0m	41cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Ivy/climbers Restricting Inspection - dense bramble undergrowth restricting inspection Major Deadwood - BRANCHES/STEMS Suppressed	None recorded..	NO ACTION REQU
34	chainage 230-240	1	1.00	Sycamore	ST82-8260-0498	13.0m	9.0m	81cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Ivy/climbers Restricting Inspection Squirrel Damage MAJOR-BRNCHS/STEMS	None recorded..	NO ACTION REQU
35	chainage 240-250	1	1.00	Scot's pine	ST82-8261-0504	18.0m	11.0m	54cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Major Deadwood - BRANCHES/STEMS Suppressed	Remove major deadwood	ESSENTIAL WORK
36	chainage 240-250	1	1.00	Hazel	ST82-8265-0506	4.0m	3.0m	20cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Coppice Derived-Multi-stemmed Ganoderma adspersum - BUTT	None recorded..	NO ACTION REQU
38	chainage 250-260	1	1.00	Sycamore	ST82-8265-0517	13.0m	9.0m	38cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Squirrel Damage MAJOR-BRNCHS/STEMS	None recorded..	NO ACTION REQU
39	chainage 260-270	1	1.00	English Oak	ST82-8270-0522	13.0m	9.0m	69cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Suppressed	None recorded..	NO ACTION REQU
37	chainage 250-260	1	1.00	Beech	ST82-8269-0511	17.0m	12.0m	69cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Co-dominant Stems Tight Forks/Included Bark-MAIN FORK	Further inspection required Landowner to commission inspection AERIAL SURVEYS/CLIMBING INSPECTIONS - climbed inspection required to asses main branch union	RECOMMENDED WORK
40	chainage 260-270	1	1.00	Hazel	ST82-8269-0526	3.0m	5.0m	21cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Squirrel Damage MAJOR-BRNCHS/STEMS	None recorded..	NO ACTION REQU
41	chainage 260-270	1	1.00	Sycamore	ST82-8268-0528	10.0m	3.0m	40cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Suppressed	None recorded..	NO ACTION REQU
42	chainage 270-280	1	1.00	English Oak	ST82-8274-0528	16.0m	11.0m	71cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Suppressed	None recorded..	NO ACTION REQU
43	chainage 270-280	1	1.00	Scot's pine	ST82-8274-0532	18.0m	11.0m	72cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Major Deadwood - BRANCHES/STEMS Suppressed	None recorded..	NO ACTION REQU

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
44	chainage 270-280	1	1.00	Sycamore	ST82-8272-0538	14.0m	11.0m	51cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Squirrel Damage MAJOR-BRNCHS/STEMS	None recorded..	NO ACTION REQU
45	chainage 270-280	1	1.00	Holly	ST82-8275-0538	4.0m	3.0m	12cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed	None recorded..	NO ACTION REQU
46	chainage 270-280	1	1.00	Sycamore	ST82-8277-0544	16.0m	15.0m	53cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Tight Forks/Included Bark-MAIN FORK Major Deadwood - BRANCHES/STEMS Major cavity-TRUNK > than 20% stem	Re-coppice	ESSENTIAL WORK
47	chainage 270-280	1	1.00	Ash	ST82-8273-0546	14.0m	11.0m	41cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Imbalanced crown Suppressed	Re-coppice	ESSENTIAL WORK
48	chainage 300-310	1	1.00	Scot's pine	ST82-8277-0556	18.0m	13.0m	74cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Major Deadwood - BRANCHES/STEMS Suppressed	Remove major deadwood	ESSENTIAL WORK
49	chainage 300-310	1	1.00	Scot's pine	ST82-8278-0561	16.0m	7.0m	67cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Major Deadwood - BRANCHES/STEMS Suppressed	Remove major deadwood	ESSENTIAL WORK
50	chainage 300-310	1	1.00	Sycamore	ST82-8273-0561	16.0m	13.0m	61cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Multiple Decay points-MAIN BRANCHES Raised roots/buttrressing - roots exposed through soil erosion Suppressed	None recorded..	NO ACTION REQU
51	chainage 300-310	1	1.00	Hazel	ST82-8277-0566	3.0m	5.0m	21cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Lean < than 20% Single Stemmed Raised roots/buttrressing - soil erosion around roots	Re-coppice	ESSENTIAL WORK
52	chainage 300-310	1	1.00	Hazel	ST82-8273-0571	5.0m	6.0m	23cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Lean < than 20% Single Stemmed Raised roots/buttrressing - soil erosion around roots	Re-coppice	ESSENTIAL WORK
53	chainage 330-340	1	1.00	English Oak	ST82-8278-0587	12.0m	11.0m	67cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Raised roots/buttrressing - tree located on top edge of field bank. roots exposed by soil erosion	None recorded..	NO ACTION REQU
54	chainage 330-340	1	1.00	Ash	ST82-8282-0592	16.0m	13.0m	69cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Major limb loss/failure Single Stemmed Major Deadwood - BRANCHES/STEMS Major cavity-TRUNK > than 20% stem - large cavity on main stem @ 3m, result of limb loss.	Further inspection required - inspection of cavity on stem required Landowner to commission inspection	ESSENTIAL WORK

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
56	chainage 340-350	1	1.00	Field Maple	ST82-8280-0606	11.0m	10.0m	30cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Coppice Derived-Multi-stemmed - 2 stems Imbalanced crown Raised roots/buttressing - tree growing on edge of rock overhang Suppressed	Establish new pollard points - @ 3m	ESSENTIAL WORK
55	chainage 340-350	1	1.00	Field Maple	ST82-8278-0600	8.0m	6.0m	28cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Coppice Derived-Multi-stemmed - 5 stems Imbalanced crown Raised roots/buttressing - tree growing on edge of rock overhang Suppressed	Establish new pollard points - @ 3m	ESSENTIAL WORK
57	chainage 340-350	1	1.00	Field Maple	ST82-8283-0609	12.0m	11.0m	31cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Coppice Derived-Multi-stemmed - 2 stems Imbalanced crown Raised roots/buttressing - tree growing on edge of rock overhang Suppressed	Establish new pollard points - @ 3m	ESSENTIAL WORK
58	chainage 350-360	1	1.00	Ash	ST82-8285-0611	14.0m	11.0m	36cm	Young	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Over Extended Major Branching Raised roots/buttressing	None recorded..	NO ACTION REQUIRED
59	chainage 350-360	1	1.00	Ash	ST82-8286-0612	14.0m	10.0m	35cm	Young	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Raised roots/buttressing	None recorded..	NO ACTION REQUIRED
60	chainage 350-360	1	1.00	Ash	ST82-8289-0611	14.0m	11.0m	35cm	Young	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Ivy/climbers Restricting Inspection Raised roots/buttressing	None recorded..	NO ACTION REQUIRED
61	chainage 350-360	1	1.00	Ash	ST82-8294-0620	14.0m	12.0m	37cm	Young	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Ivy/climbers Restricting Inspection Raised roots/buttressing - tree growing on rock out crop	None recorded..	NO ACTION REQUIRED
62	chainage 380-390	1	1.00	English Oak	ST82-8294-0631	11.0m	12.0m	37cm	Young	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown - Canopy leaning over field, canopy leaning due removal of adjacent tree. Ivy/climbers Restricting Inspection Raised roots/buttressing - tree growing on rock out crop Suppressed	None recorded..	NO ACTION REQUIRED
63	chainage 410-420	1	1.00	Hawthorn	ST82-8293-0662	6.0m	5.0m	25cm	Semi-mature	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Multi-Stemmed Raised roots/buttressing	None recorded..	NO ACTION REQUIRED

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
64	chainage 410-420	1	1.00	English Oak	ST82-8293-0671	10.0m	9.0m	38cm	Young	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Moderate limb loss/failure - Storm Single Stemmed Imbalanced crown Large branches lost recently- Tears Hanging broken branch Raised roots/buttrressing Tight Forks/Included Bark @ > 1.5m	Crown Reduction by - reduce canopy by 4-5m to internal growth	ESSENTIAL WORK
65	chainage 420-430	1	1.00	English Oak	ST82-8292-0681	7.0m	6.0m	35cm	Young	Medium 75%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Coppice Derived-Multi-stemmed Imbalanced crown Raised roots/buttrressing	Crown Reduction by - reduce canopy by 4-5m to internal growth	ESSENTIAL WORK
66	chainage 450-460	1	1.00	English Oak	ST82-8291-0698	11.0m	10.0m	45cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Moderate limb loss/failure - Storm Single Stemmed Imbalanced crown Large branches lost recently- Tears Hanging broken branch Raised roots/buttrressing Rot/decay- TRUNK - large lateral cavity on main stem	Further inspection required Landowner to commission inspection Crown Reduction by - by 3-4m	ESSENTIAL WORK
68	chainage 460-470	1	1.00	Field Maple	ST82-8291-0721	9.0m	5.0m	21cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Single Stemmed Imbalanced crown Suppressed	Crown lift to 5.2m over Highway	ESSENTIAL WORK
67	chainage 450-460	1	1.00	Ash	ST82-8290-0705	11.0m	12.0m	26cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Coppice Derived-Multi-stemmed Basal rot/cavity Raised roots/buttrressing	Re-coppice	ESSENTIAL WORK
69	chainage 460-470	1	1.00	Field Maple	ST82-8291-0724	10.0m	6.0m	21cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Moderate limb loss/failure - Storm Multi-Stemmed Imbalanced crown Suppressed	Re-coppice	ESSENTIAL WORK
70	chainage 460-470	1	1.00	Field Maple	ST82-8289-0738	11.0m	10.0m	22cm	Semi-mature	Low 50%	Public Access - HIGH Tree located in adjacent property Steep Roadside Bank - Edge/Side Road within fall zone	Coppice Derived-Multi-stemmed	Crown lift to 5.2m over Highway	ESSENTIAL WORK
Grp/1	chainage 490-500	22	22.00	Holly	ST82-8280-0756	7.0m	4.0m	0cm	Mature	Medium 75%	Public Access - MODERATE Tree located in adjacent property Highway verge-rural (unmaintained) Steep Roadside Bank - Edge/Side Hedgerow - Overgrown Road within fall zone	Multi-Stemmed Rot/decay- TRUNK Tight Forks/Included Bark @ < 1.5m	Crown lift to 5.2m over Highway (x 0 tree)	ESSENTIAL WORK
Grp/3	chainage 370-410	6	6.00	Hazel	ST82-8294-0658	7.0m	4.0m	0cm	Mature	Medium 75%	Public Access - MODERATE Tree located in adjacent property Highway verge-rural (unmaintained) Steep Roadside Bank - Edge/Side Hedgerow - Overgrown Road within fall zone	Multi-Stemmed Tight Forks/Included Bark @ < 1.5m	Re-coppice (x 0 tree)	ESSENTIAL WORK

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
Grp/2	chainage 410-490	7	7.00	Hazel	ST82-8292-0735	7.0m	4.0m	0cm	Mature	Medium 75%	Public Access - MODERATE Tree located in adjacent property Highway verge-rural (unmaintained) Steep Roadside Bank - Edge/Side Hedgerow - Overgrown Road within fall zone	Multi-Stemmed Tight Forks/Included Bark @ < 1.5m	Re-coppice (x 0 tree)	ESSENTIAL WORK
Grp/4	chainage 290-370	5	5.00	Hazel	ST82-8295-0617	7.0m	4.0m	0cm	Mature	Medium 75%	Public Access - MODERATE Tree located in adjacent property Highway verge-rural (unmaintained) Steep Roadside Bank - Edge/Side Hedgerow - Overgrown Road within fall zone	Multi-Stemmed Tight Forks/Included Bark @ < 1.5m	Re-coppice (x 0 tree) - trees leaning towards highway only	ESSENTIAL WORK
Grp/5	chainage 90-240	1	1.00	Mixed Broadleaves	ST82-8265-0503	7.0m	4.0m	0cm	Mature	Medium 75%	Public Access - MODERATE Tree located in adjacent property Highway verge-rural (unmaintained) Steep Roadside Bank - Edge/Side Hedgerow - Overgrown Road within fall zone	Multi-Stemmed Tight Forks/Included Bark @ < 1.5m	Re-coppice (x 0 tree) - trees leaning towards highway only	ESSENTIAL WORK
0.08	chainage 380-390	1	1.00	Sycamore	ST82-8296-0627	1.0m	1.0m	16cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Stump	Fell to ground level	ESSENTIAL WORK
0.07	chainage 290-300	1	1.00	Sycamore	ST82-8277-0549	1.0m	1.0m	16cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Stump	Fell to ground level	ESSENTIAL WORK
71	chainage 70-80	1	1.00	Hornbeam	ST82-8223-0344	10.0m	6.0m	25cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Multi-Stemmed Low Pendulous Major Branching	Crown lift to 5.2m over Highway	ESSENTIAL WORK
0.06	chainage 290-300	1	1.00	Sycamore	ST82-8278-0549	1.0m	1.0m	16cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Stump	Fell to ground level	ESSENTIAL WORK
0.05	chainage 230-240	1	1.00	Ash	ST82-8260-0472	1.0m	1.0m	16cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Stump	Fell to ground level	ESSENTIAL WORK
0.04	chainage 180-190	1	1.00	Sycamore	ST82-8241-0442	1.0m	1.0m	16cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Stump	Fell to ground level	ESSENTIAL WORK
72	chainage 80-90	1	1.00	Hazel	ST82-8224-0350	4.0m	3.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed	None recorded..	NO ACTION REQUIRED
0.03	chainage 160-170	1	1.00	Sycamore	ST82-8235-0417	1.0m	1.0m	16cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Stump	Fell to ground level	ESSENTIAL WORK
0.02	chainage 80-90	1	1.00	'Species unknown'	ST82-8218-0365	1.0m	1.0m	16cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Stump	Fell to ground level	ESSENTIAL WORK
0.01	chainage 80-90	1	1.00	'Species unknown'	ST82-8218-0357	1.0m	1.0m	16cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Stump	Fell to ground level	ESSENTIAL WORK

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
73	chainage 80-90	1	1.00	Hazel	ST82-8225-0353	4.0m	3.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Suppressed	None recorded..	NO ACTION REQU
0.23 (2.3)	chainage 100-110	1	1.00	'Species unknown'	ST82-8231-0363	2.0m	1.0m	16cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Stump	Fell to ground level	ESSENTIAL WORK
0.21 (2.01)	chainage 80-90	1	1.00	'Species unknown'	ST82-8226-0362	1.0m	1.0m	16cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Stump	Fell to ground level	ESSENTIAL WORK
0.22 (2.2)	chainage 100-110	1	1.00	Sycamore	ST82-8227-0365	5.0m	1.0m	16cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Stump	Fell to ground level	ESSENTIAL WORK
74	chainage 80-90	1	1.00	Hazel	ST82-8225-0355	4.0m	3.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WORK
0.24 (2.4)	chainage 110-120	1	1.00	Ash	ST82-8227-0367	5.0m	1.0m	16cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Basal rot/cavity Stump	Fell to ground level	ESSENTIAL WORK
0.05	chainage 110-120	1	1.00	Sycamore	ST82-8243-0394	5.0m	1.0m	36cm	Semi-mature	Dying 25%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Basal rot/cavity Stump	Fell to ground level	ESSENTIAL WORK
0.26 (2.6)	chainage 130-140	1	1.00	Sycamore	ST82-8241-0397	5.0m	1.0m	36cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Stump	Fell to ground level	ESSENTIAL WORK
75	chainage 90-100	1	1.00	Hazel	ST82-8226-0357	2.0m	2.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WORK
0.27 (2.7)	chainage 130-140	1	1.00	Ash	ST82-8245-0414	5.0m	1.0m	36cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Stump	Fell to ground level	ESSENTIAL WORK
0.28 (2.8)	chainage 200-210	1	1.00	Sycamore	ST82-8267-0464	5.0m	1.0m	36cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Raised roots/buttrressing - significant soil erosion around roots Stump	Fell to ground level	ESSENTIAL WORK
0.29 (2.9)	chainage 200-210	1	1.00	Ash	ST82-8273-0465	5.0m	1.0m	36cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Stump	Fell to ground level	ESSENTIAL WORK
76	chainage 90-100	1	1.00	Hazel	ST82-8229-0358	4.0m	5.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
0.30 (2.1)	chainage 210-220	1	1.00	Ash	ST82-8270-0467	5.0m	1.0m	24cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Raised roots/buttrressing - significant soil erosion around roots Stump	Fell to ground level	ESSENTIAL WORK

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
2.11	chainage 220-230	1	1.00	Ash	ST82-8267-0472	5.0m	1.0m	24cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Raised roots/buttressing - significant soil erosion around roots Stump	Fell to ground level	ESSENTIAL WORK
0.32 (2.12)	chainage 200-210	1	1.00	Sycamore	ST82-8284-0506	5.0m	1.0m	24cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Raised roots/buttressing - significant soil erosion around roots Stump	Fell to ground level	ESSENTIAL WORK
77	chainage 90-100	1	1.00	Holly	ST82-8227-0360	2.0m	1.0m	14cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Suppressed	None recorded..	NO ACTION REQU
0.33 (2.13)	chainage 200-210	1	1.00	Beech	ST82-8289-0521	5.0m	1.0m	24cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Raised roots/buttressing - significant soil erosion around roots Stump	Fell to ground level	ESSENTIAL WORK
0.34 (2.14)	chainage 200-210	1	1.00	Ash	ST82-8290-0545	5.0m	1.0m	24cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Raised roots/buttressing - significant soil erosion around roots Stump	Fell to ground level	ESSENTIAL WORK
0.35 (2.15)	chainage 300-310	1	1.00	Sycamore	ST82-8293-0556	5.0m	1.0m	24cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Top Road within canopy	Coppice Derived-Multi-stemmed Fungal Fruiting Bodies - BUTT Basal rot/cavity Raised roots/buttressing - significant soil erosion around roots Stump	Fell to ground level	ESSENTIAL WORK
78	chainage 110-120	1	1.00	Field Maple	ST82-8239-0379	6.0m	6.0m	25cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Multi-Stemmed Dieback - Crown Major Deadwood - BRANCHES/STEMS Suppressed	Re-coppice	ESSENTIAL WORK
369140 (79)	chainage 120-130	1	1.00	Sycamore	ST82-8237-0382	11.0m	8.0m	35cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Dieback - Crown Major Deadwood - BRANCHES/STEMS Raised roots/buttressing - roots exposed by soil erosion Suppressed	Fell to ground level	ESSENTIAL WORK
369144 (80)	chainage 120-130	1	1.00	Sycamore	ST82-8238-0388	11.0m	8.0m	35cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy Electric Cables overhead/nearby	Single Stemmed Dieback - Crown Major Deadwood - BRANCHES/STEMS Raised roots/buttressing - roots exposed by soil erosion Suppressed	Fell to ground level	ESSENTIAL WORK
81	chainage 120-130	1	1.00	Hazel	ST82-8239-0391	4.0m	5.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK

Area 6 - North Darset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
82	chainage 90-100	1	1.00	Hazel	ST82-8240-0393	4.0m	5.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
83	chainage 130-140	1	1.00	Hazel	ST82-8242-0395	3.0m	3.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
84	chainage 130-140	1	1.00	Sycamore	ST82-8243-0399	4.0m	3.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
85	chainage 130-140	1	1.00	Holly	ST82-8241-0400	4.0m	3.0m	15cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
86	chainage 140-150	1	1.00	Ash	ST82-8241-0402	4.0m	2.0m	11cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
87	chainage 140-150	1	1.00	Hazel	ST82-8242-0403	4.0m	4.0m	11cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
88	chainage 150-160	1	1.00	Small leafed lime	ST82-8249-0415	16.0m	8.0m	41cm	Mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Multi-Stemmed Co-dominant Stems Major Deadwood - BRANCHES/STEMS Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Remove major deadwood	ESSENTIAL WORK
89	chainage 160-170	1	1.00	English Oak	ST82-8251-0417	16.0m	9.0m	41cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Suppressed	None recorded..	NO ACTION REQU
90	chainage 160-170	1	1.00	Hawthorn	ST82-8253-0422	9.0m	5.0m	21cm	Mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Co-dominant Stems Suppressed	None recorded..	NO ACTION REQU
369188 (91)	chainage 170-180	1	1.00	Sycamore	ST82-8257-0432	17.0m	12.0m	21cm	Mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Multi-Stemmed Co-dominant Stems Suppressed Tight Forks/Included Bark @ > 1.5m Tight Forks/Included Bark @ < 1.5m	None recorded..	NO ACTION REQU
92	chainage 150-160	1	1.00	Holly	ST82-8245-0415	4.0m	3.0m	15cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
93	chainage 160-170	1	1.00	Sycamore	ST82-8247-0424	12.0m	9.0m	33cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK

Area 6 - North Dorset ... (contd) ..

C13 - Dinah's Hollow - Melbury Abbas ... (contd) ..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
94	chainage 170-180	1	1.00	Ash	ST82-8249-0433	15.0m	11.0m	53cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Major limb loss/failure Single Stemmed Dieback - Crown Imbalanced crown Raised roots/buttressing - roots exposed by soil erosion Suppressed	Fell to ground level	ESSENTIAL WORK
95	chainage 180-190	1	1.00	Ash	ST82-8257-0441	13.0m	9.0m	53cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Dieback - Crown Imbalanced crown Raised roots/buttressing - roots exposed by soil erosion Suppressed Cankers - TRUNK	Crown Reduction by - 2m	ESSENTIAL WORK
96	chainage 180-190	1	1.00	Sycamore	ST82-8260-0442	6.0m	3.0m	17cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Basal rot/cavity	Re-coppice	ESSENTIAL WORK
97	chainage 190-200	1	1.00	Hazel	ST82-8261-0444	4.0m	4.0m	11cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
98	chainage 190-200	1	1.00	Hazel	ST82-8262-0445	5.0m	6.0m	11cm	Mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Cracked/Lifting Bark-BRANCHES/STEMS Broken/lost leader Raised roots/buttressing - roots exposed by soil erosion Suppressed Rot/decay-TRUNK	Re-coppice	ESSENTIAL WORK
99	chainage 190-200	1	1.00	Hazel	ST82-8265-0447	5.0m	8.0m	11cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Collapsed tree Coppice Derived-Multi-stemmed Raised roots/buttressing - roots exposed by soil erosion Suppressed	Re-coppice	ESSENTIAL WORK
100	chainage 200-210	1	1.00	Sycamore	ST82-8265-0456	15.0m	11.0m	36cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Imbalanced crown - due to removal of a large tree adjacent Suppressed	Formative and corrective pruning - rebalance canopy	ESSENTIAL WORK
101	chainage 210-220	1	1.00	English Oak	ST82-8271-0462	13.0m	8.0m	46cm	Semi-mature	Dead 0%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Dead Single Stemmed	ALERT OWNER OF TREE ON PRIVATE LAND Tree/s pose a threat to the highway Section 154(1) Notice Required Fell to ground level	ESSENTIAL WORK
102	chainage 220-230	1	1.00	Hazel	ST82-8273-0467	3.0m	3.0m	11cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Root plate compromise Raised roots/buttressing - soil erosion around roots - landslip Suppressed	Re-coppice	ESSENTIAL WORK
103	chainage 220-230	1	1.00	Hazel	ST82-8275-0469	3.0m	4.0m	11cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WORK
104	chainage 230-240	1	1.00	Hazel	ST82-8273-0473	4.0m	6.0m	19cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WORK

Area 6 - North Dorset ... (contd) ..

C13 - Dinah's Hollow - Melbury Abbas ... (contd) ..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
105	chainage 230-240	1	1.00	English Oak	ST82-8277-0478	13.0m	9.0m	51cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Lean < than 20% Single Stemmed Imbalanced crown Raised roots/buttrressing Suppressed	None recorded..	NO ACTION REQU
106	chainage 230-240	1	1.00	Hazel	ST82-8275-0484	4.0m	6.0m	19cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Lean > than 20% - tree leans at 90% angle over highway Coppice Derived-Multi-stemmed Suppressed Fungal Fruiting Bodies - TRUNK	Re-coppice	ESSENTIAL WOR
107	chainage 250-260	1	1.00	Sycamore	ST82-8281-0499	15.0m	13.0m	56cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Suppressed	None recorded..	NO ACTION REQU
108	chainage 260-270	1	1.00	Sycamore	ST82-8283-0510	15.0m	9.0m	56cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Group effect or touching canopies - cohesive canopy with T109 Suppressed	None recorded..	NO ACTION REQU
109	chainage 260-270	1	1.00	Sycamore	ST82-8288-0512	15.0m	9.0m	38cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Group effect or touching canopies - cohesive canopy with T108 Basal rot/cavity Suppressed	Further inspection required - assess extent of decay at base Landowner to commission inspection	ESSENTIAL WOR
110	chainage 260-270	1	1.00	Sycamore	ST82-8290-0517	5.0m	4.0m	16cm	Young	Dying 25%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Dying Single Stemmed Coppice Derived-Multi-stemmed - group of small single stemmed trees Group effect or touching canopies - cohesive canopy with T108 Basal rot/cavity Verticillium Wilt Suppressed	Re-coppice	ESSENTIAL WOR
111	chainage 280-290	1	1.00	Hazel	ST82-8295-0535	3.0m	4.0m	19cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - significant soilerosion around roots Suppressed	Re-coppice	ESSENTIAL WOR
112	chainage 290-300	1	1.00	English Oak	ST82-8296-0541	14.0m	11.0m	53cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Lean < than 20% Single Stemmed Imbalanced crown Raised roots/buttrressing Suppressed	None recorded..	NO ACTION REQU
113	chainage 2290-300	1	1.00	Sycamore	ST82-8294-0543	15.0m	8.0m	35cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Group effect or touching canopies - cohesive canopy with T114 Suppressed	None recorded..	NO ACTION REQU
114	chainage 290-300	1	1.00	Sycamore	ST82-8292-0548	14.0m	7.0m	33cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Co-dominant stems Group effect or touching canopies - cohesive canopy with T113 Imbalanced crown Suppressed	None recorded..	NO ACTION REQU

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..

Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
115	chainage 300-310	1	1.00	Holly	ST82-8295-0552	6.0m	3.0m	15cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Multi-Stemmed Suppressed	None recorded..	NO ACTION REQU
116	chainage 300-310	1	1.00	Hazel	ST82-8295-0555	3.0m	4.0m	15cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttressing - significant soil erosion around roots Suppressed	Re-coppice	ESSENTIAL WOR
117	chainage 160-170	1	1.00	Hawthorn	ST82-8296-0559	5.0m	3.0m	19cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Co-dominant Stems Suppressed	None recorded..	NO ACTION REQU
118	chainage 300-310	1	1.00	Hazel	ST82-8297-0567	3.0m	6.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WOR
119	chainage 320-330	1	1.00	Hazel	ST82-8292-0565	3.0m	6.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WOR
120	chainage 320-330	1	1.00	English Oak	ST82-8293-0581	7.0m	7.0m	21cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Lean < than 20% Single Stemmed Imbalanced crown - leaning canopy form, growing over highway Low Pendulous Major Branching Suppressed	Formative and corrective pruning - rebalance canopy Crown lift to 5.2m over Highway	ESSENTIAL WOR
121	chainage 320-330	1	1.00	Sycamore	ST82-8295-0584	8.0m	5.0m	19cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Imbalanced crown Low Pendulous Major Branching Suppressed	Crown lift to 5.2m over Highway	ESSENTIAL WOR
122	chainage 320-330	1	1.00	English Oak	ST82-8300-0584	13.0m	16.0m	72cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Major limb loss/failure Lean < than 20% Multi-Stemmed Co-dominant Stems Low Pendulous Major Branching Over Extended Major Branching Raised roots/buttressing - roots exposed by soil erosion	Crown Reduction by - up to 3m	ESSENTIAL WOR
123	chainage 320-330	1	1.00	Hazel	ST82-8297-0593	3.0m	6.0m	16cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WOR
124	chainage 340-350	1	1.00	Ash	ST82-8300-0598	11.0m	6.0m	23cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Raised roots/buttressing - roots exposed by soil erosion, tree rooted into top edge of bank. Suppressed	None recorded..	NO ACTION REQU
125	chainage 350-360	1	1.00	English Oak	ST82-8302-0604	15.0m	17.0m	74cm	Semi-mature	Medium 75%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Co-dominant Stems Raised roots/buttressing - roots exposed by soil erosion	None recorded..	NO ACTION REQU
126	chainage 360-370	1	1.00	Hazel	ST82-8304-0612	3.0m	6.0m	14cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttressing Suppressed	Re-coppice	ESSENTIAL WOR

Area 6 - North Dorset ... (contd) ..



C13 - Dinah's Hollow - Melbury Abbas ... (contd) ..


Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
127	chainage 360-370	1	1.00	Hazel	ST82-8305-0616	3.0m	6.0m	14cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing Suppressed	Re-coppice	ESSENTIAL WORK
128	chainage 360-370	1	1.00	Hazel	ST82-8307-0620	3.0m	6.0m	14cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Raised roots/buttrressing - tree root plate on edge of land slip Suppressed	Re-coppice	ESSENTIAL WORK
129	chainage 370-380	1	1.00	Ash	ST82-8305-0627	6.0m	2.0m	12cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed	None recorded..	NO ACTION REQUIRED
130	chainage 370-380	1	1.00	Hazel	ST82-8307-0625	3.0m	4.0m	12cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WORK
131	chainage 370-380	1	1.00	Hazel	ST82-8308-0628	3.0m	4.0m	12cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WORK
132	chainage 380-390	1	1.00	Hazel	ST82-8306-0630	3.0m	4.0m	12cm	Semi-mature	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Coppice Derived-Multi-stemmed Suppressed	Re-coppice	ESSENTIAL WORK
133	chainage 380-390	1	1.00	Ash	ST82-8308-0638	8.0m	6.0m	12cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Co-dominant Stems	None recorded..	NO ACTION REQUIRED
134	chainage 380-390	1	1.00	Ash	ST82-8305-0638	6.0m	2.0m	12cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed	None recorded..	NO ACTION REQUIRED
135	chainage 380-390	1	1.00	Ash	ST82-8306-0643	4.0m	2.0m	10cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed	None recorded..	NO ACTION REQUIRED
136	chainage 390-400	1	1.00	Ash	ST82-8306-0646	4.0m	2.0m	10cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed	None recorded..	NO ACTION REQUIRED
137	chainage 420-430	1	1.00	English Oak	ST82-8306-0684	6.0m	4.0m	10cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed	None recorded..	NO ACTION REQUIRED
138	chainage 420-430	1	1.00	Ash	ST82-8304-0689	7.0m	5.0m	16cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Co-dominant Stems	None recorded..	NO ACTION REQUIRED

Area 6 - North Dorset ... (contd)..

C13 - Dinah's Hollow - Melbury Abbas ... (contd)..


Tree No	Location	Trees	Hectares	Common name	O/s Grid Ref	Height	Spread	Trunk	Age Class	Vigour/FV	Site features	Condition	Recommendations	Priority
Grp/7		155	155.00	Mixed Broadleaves	ST82-8303-0645	6.0m	4.0m	0cm	Young	Medium 75%	Public Access - MODERATE Steep Roadside Bank - Edge/Side Steep Roadside Bank - Top Road within canopy	Lean < than 20% Single Stemmed Natural Regeneration/self set tree Imbalanced crown Suppressed	Further inspection required (x 0 tree) - This is dense area of young tree, mainly made up of ash with some hazel, hawthorn and sycamore. Ideally this are should be thinned out quite considerably with the intention of retaining some of the better trees to grow to become mature specimens. Crown lift to 5.2m over Highway (x 0 tree) - there are several young trees within this group that are growing close to the edge of the highway, these trees need to be removed as they will either get damaged by passing traffic or effect the highway at a later date.	ESSENTIAL WORK
139	chainage 460-470	1	1.00	Ash	ST82-8305-0729	9.0m	6.0m	19cm	Young	Low 50%	Public Access - HIGH Steep Roadside Bank - Edge/Side Road within canopy	Single Stemmed Co-dominant Stems	Formative and corrective pruning - remove co-dominant stem towards highway at main fork, reduce co-dominant stem over field allowing central stem to grow on as new leader	ESSENTIAL WORK
Grp/6	chainage	100	100.00	Mixed Broadleaves	ST82-8220-0347	7.0m	4.0m	0cm	Young	Medium 75%	Public Access - MODERATE Tree located in adjacent property Highway verge-rural (unmaintained) Steep Roadside Bank - Edge/Side Hedgerow - Overgrown Road within fall zone	Multi-Stemmed Single Stemmed Natural Regeneration/self set tree Raised roots/buttrressing Tight Forks/Included Bark @ < 1.5m	Re-coppice (x 0 tree) - trees leaning towards highway and those growing on sedges of landslips only	ESSENTIAL WORK
						Sub-total:	458	trees						
						Total:	458	trees						
Notes:-						Overall total:		458	trees					

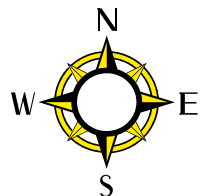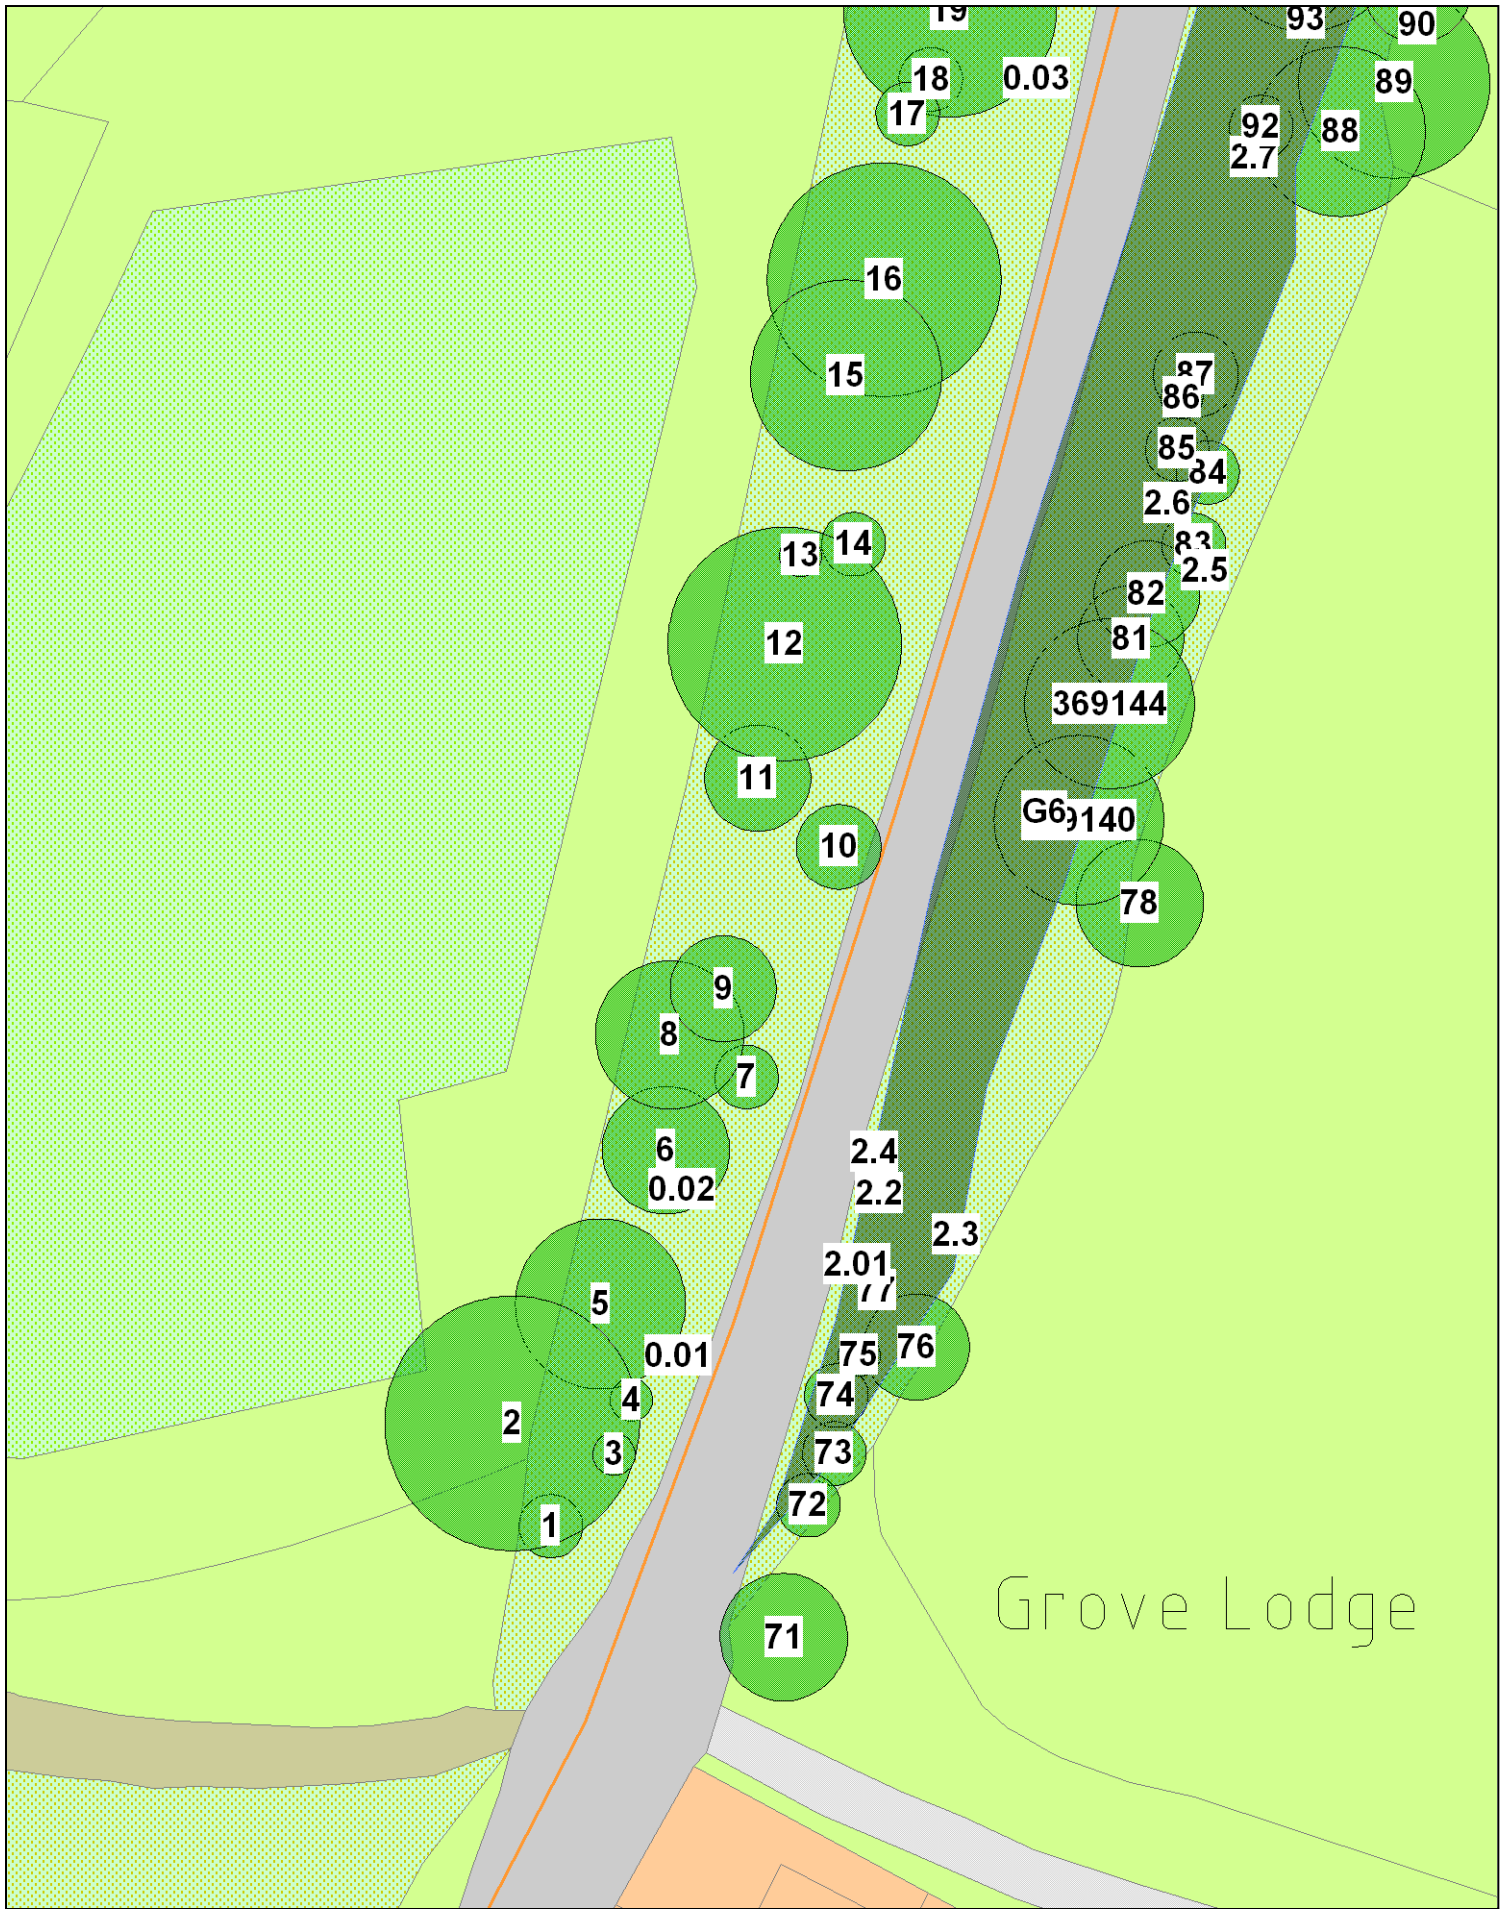


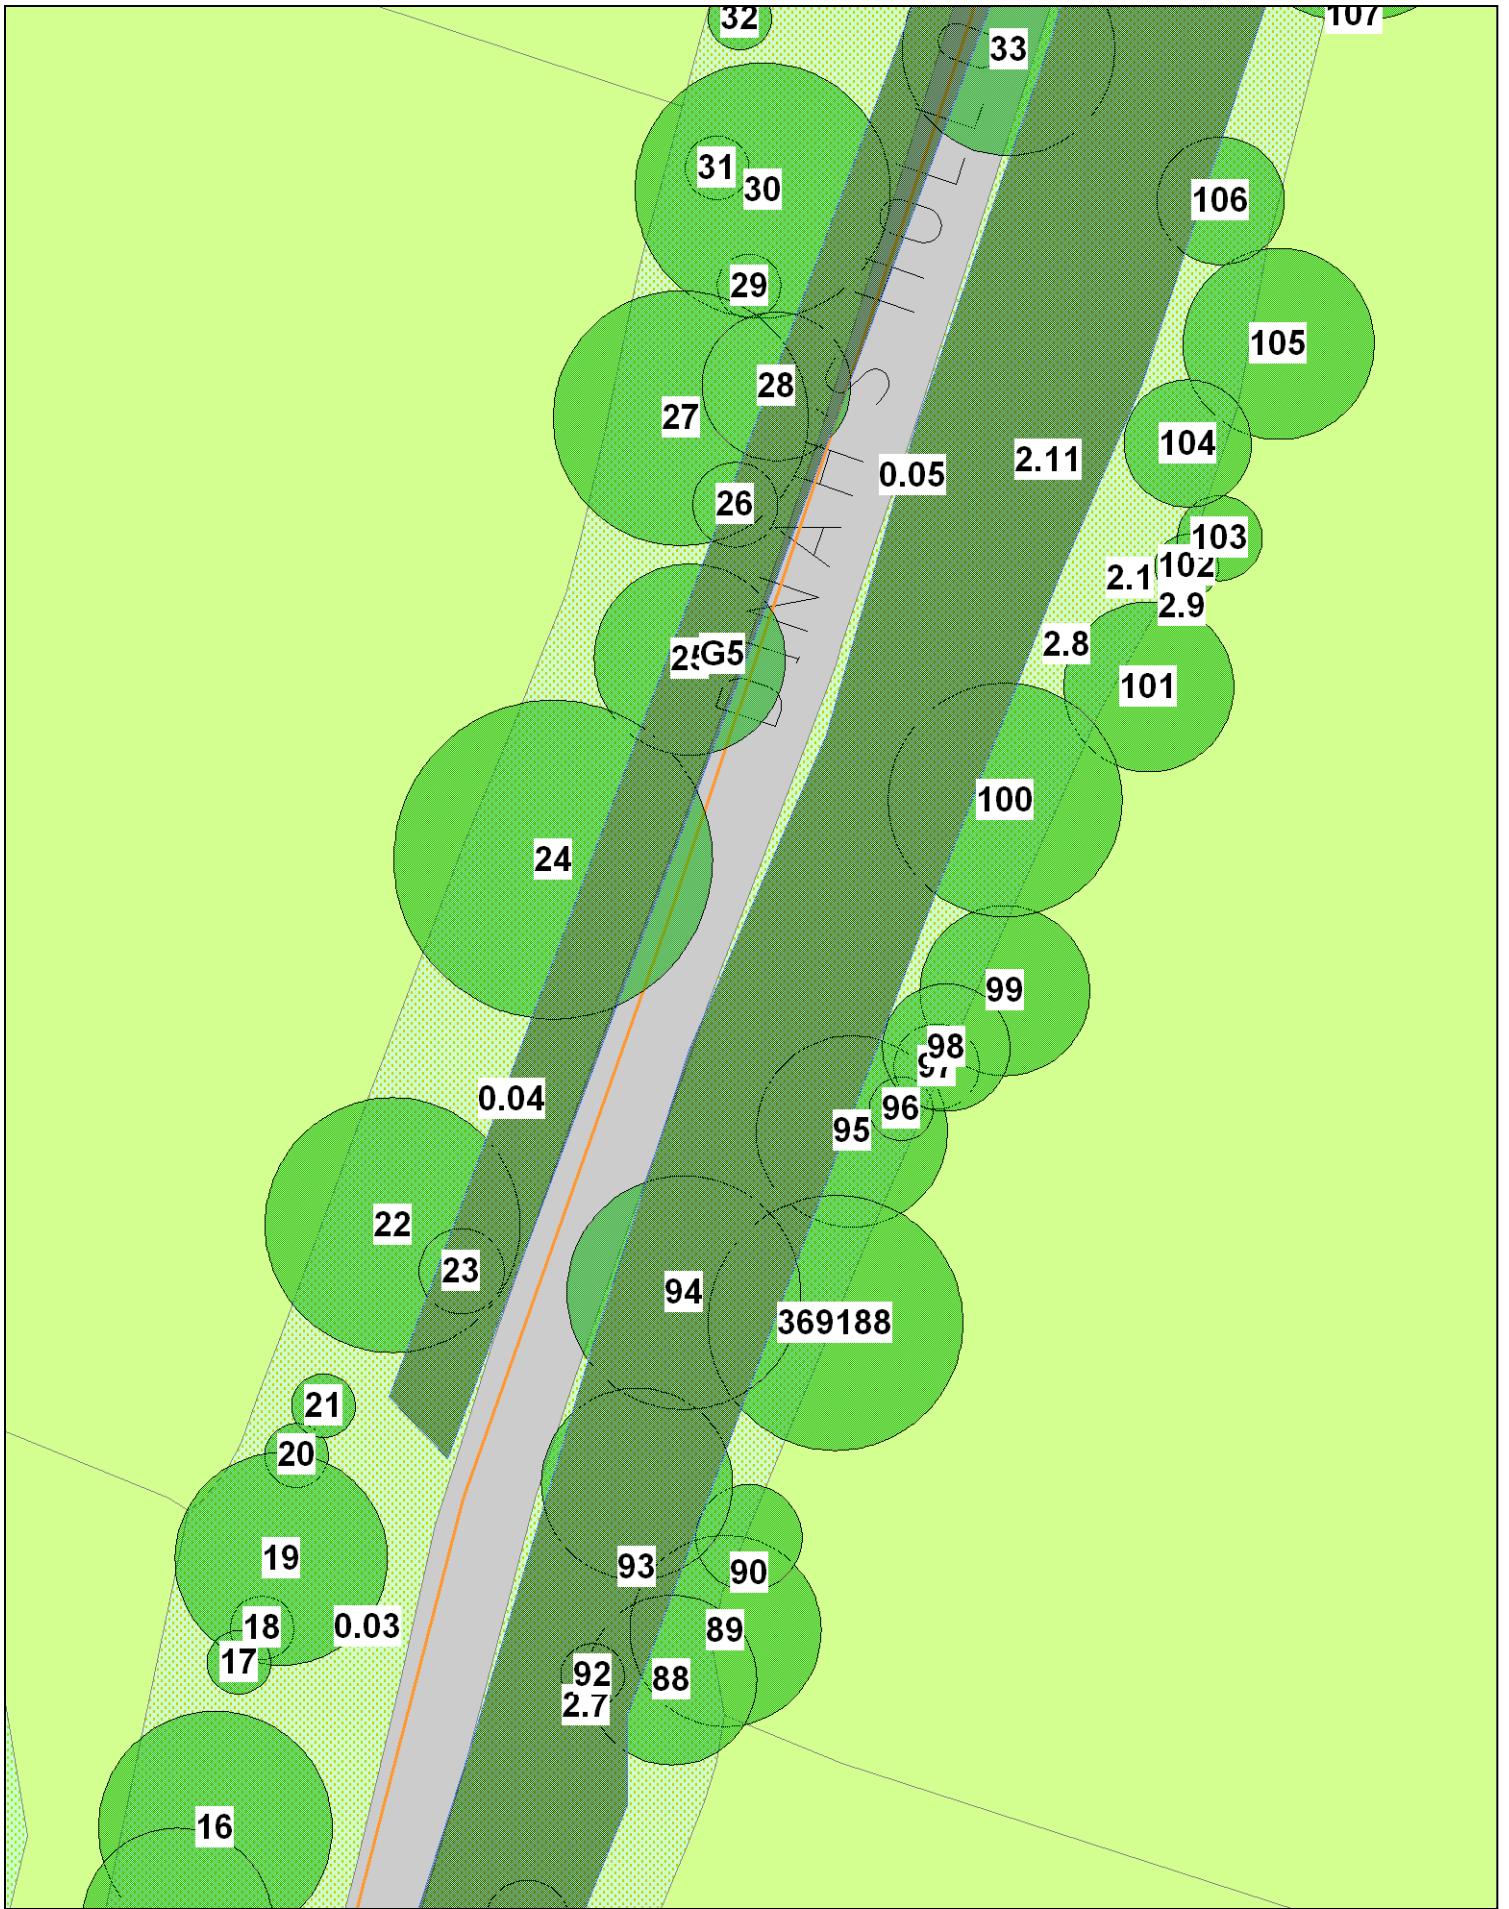


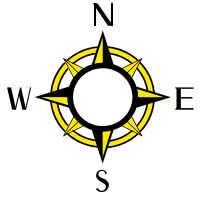
C13 - Dinah's Hollow - Melbury Abbas



Scale	Unknown
Date	14/07/2014


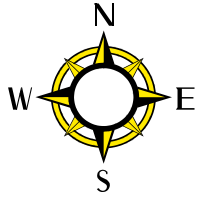


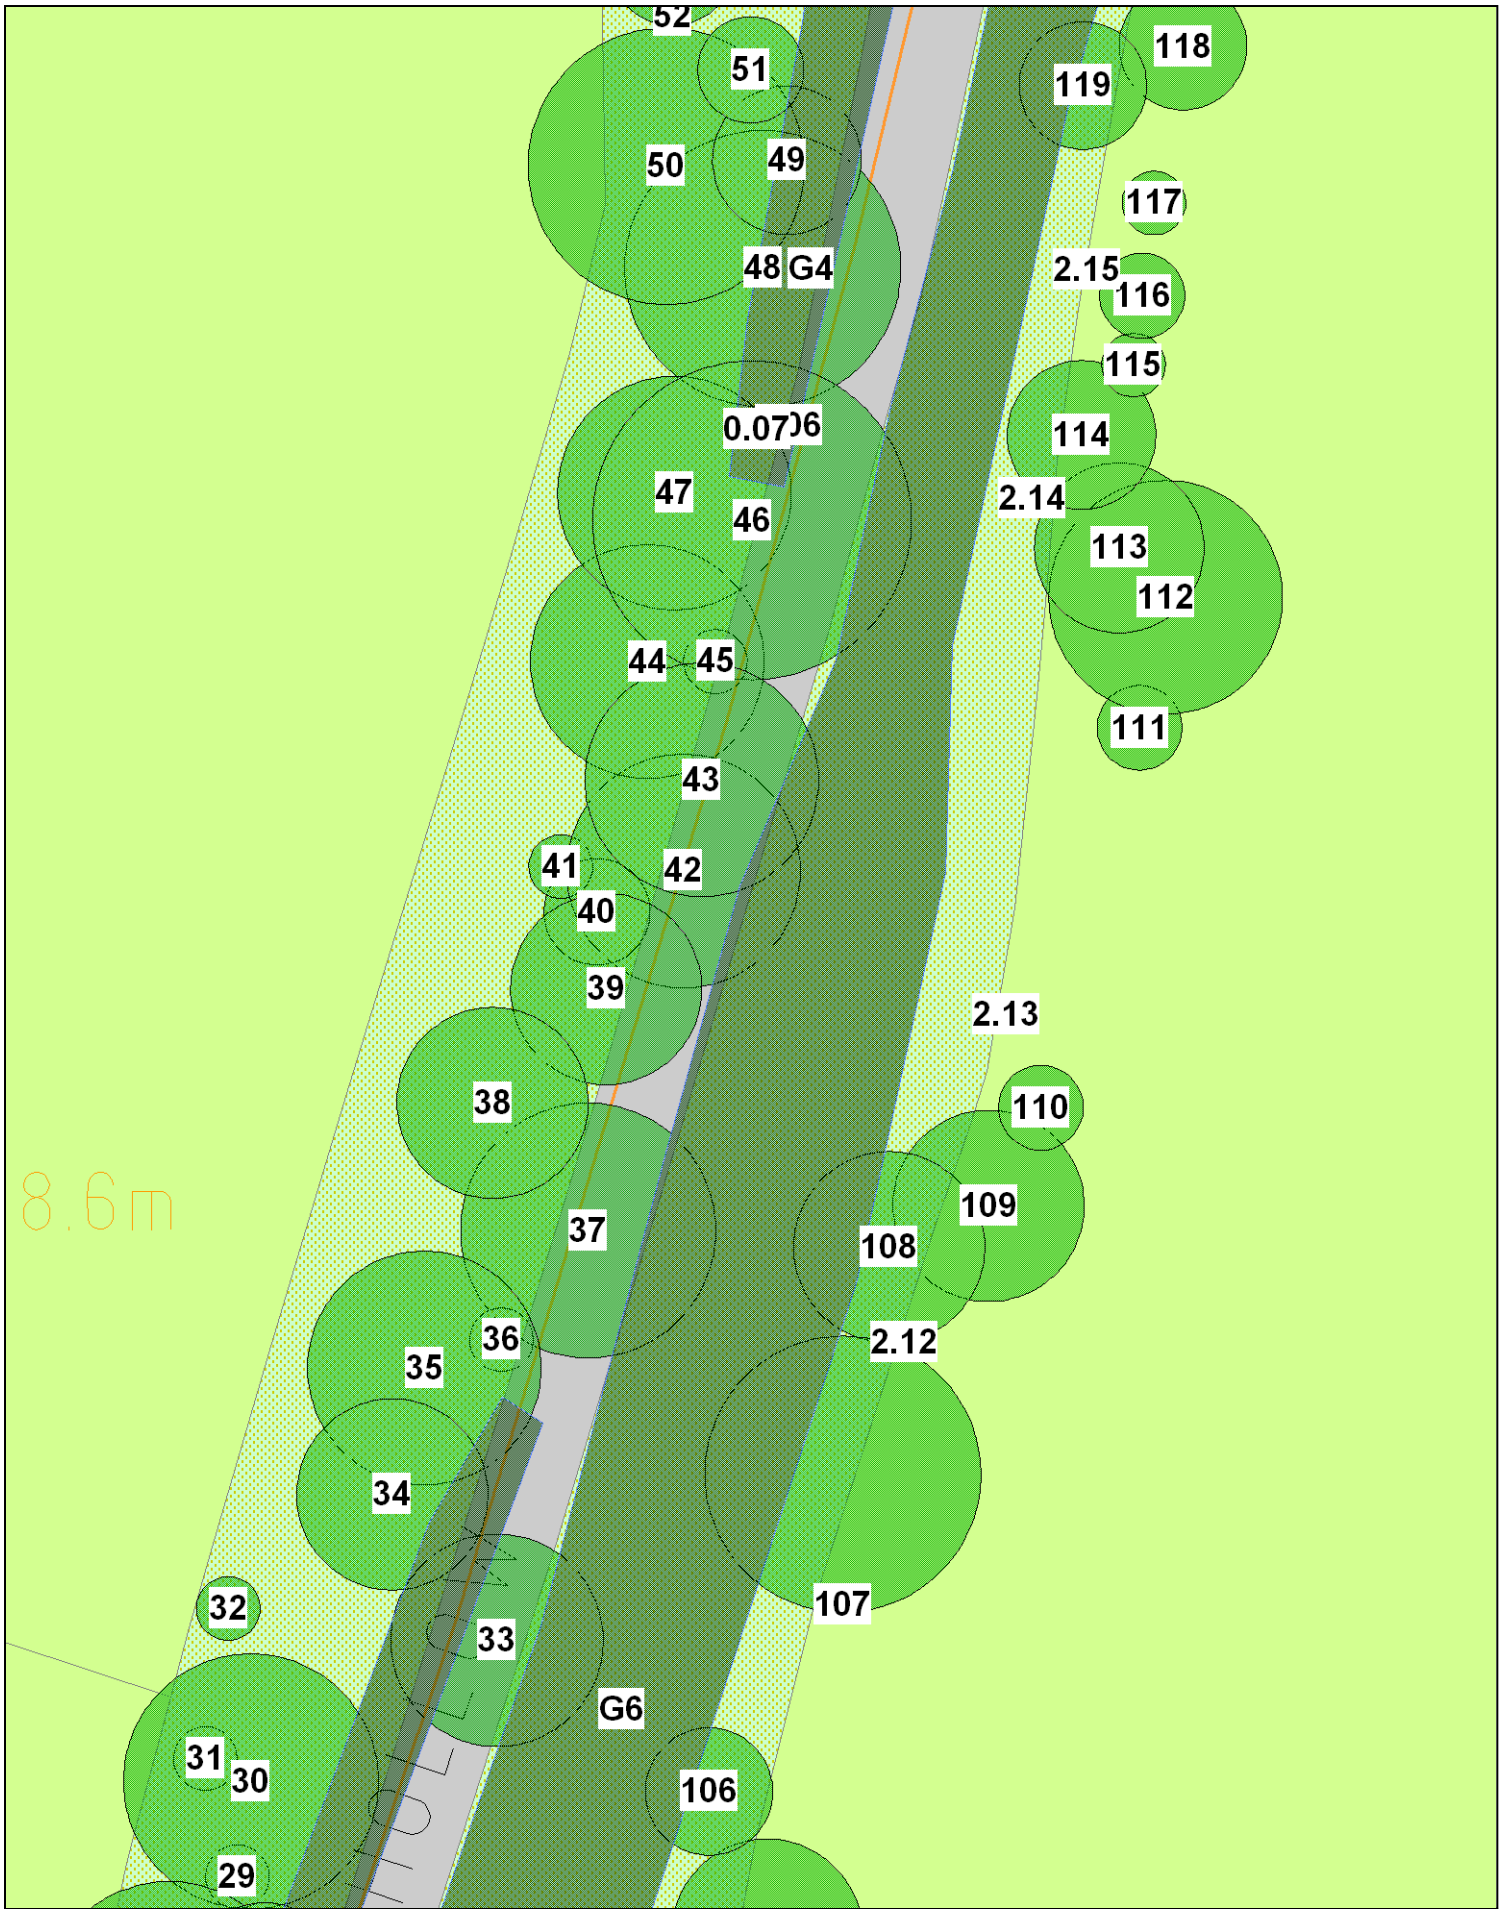


8.6m


	C13 - Dinah's Hollow - Melbury Abbas	Scale Unknown	
		Date 14/07/2014	

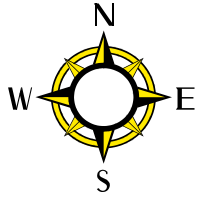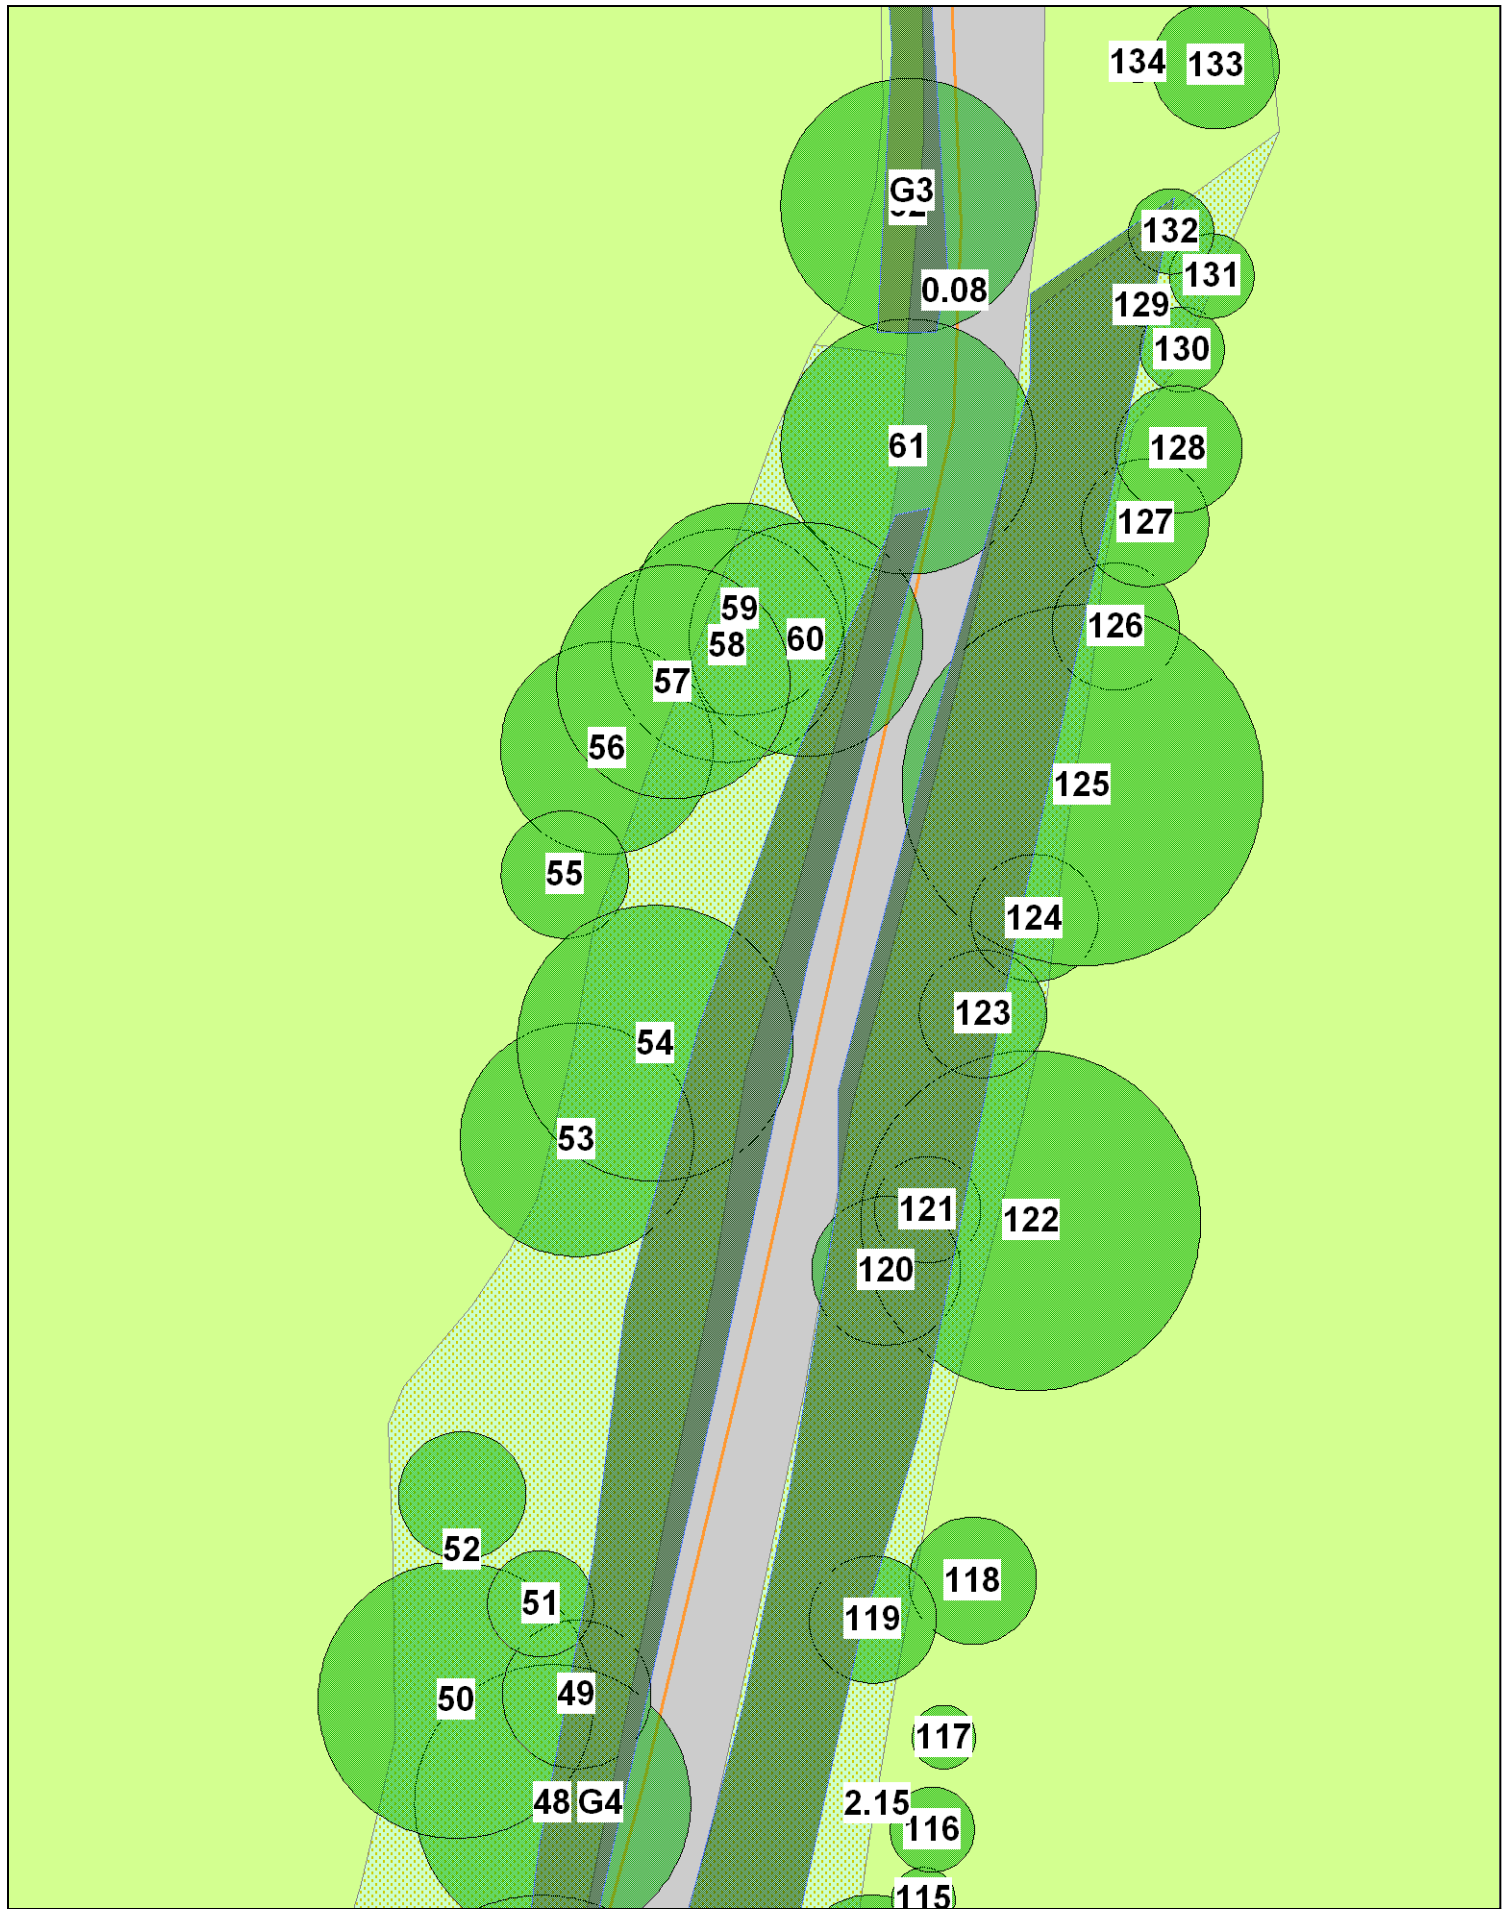

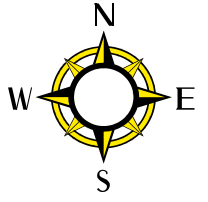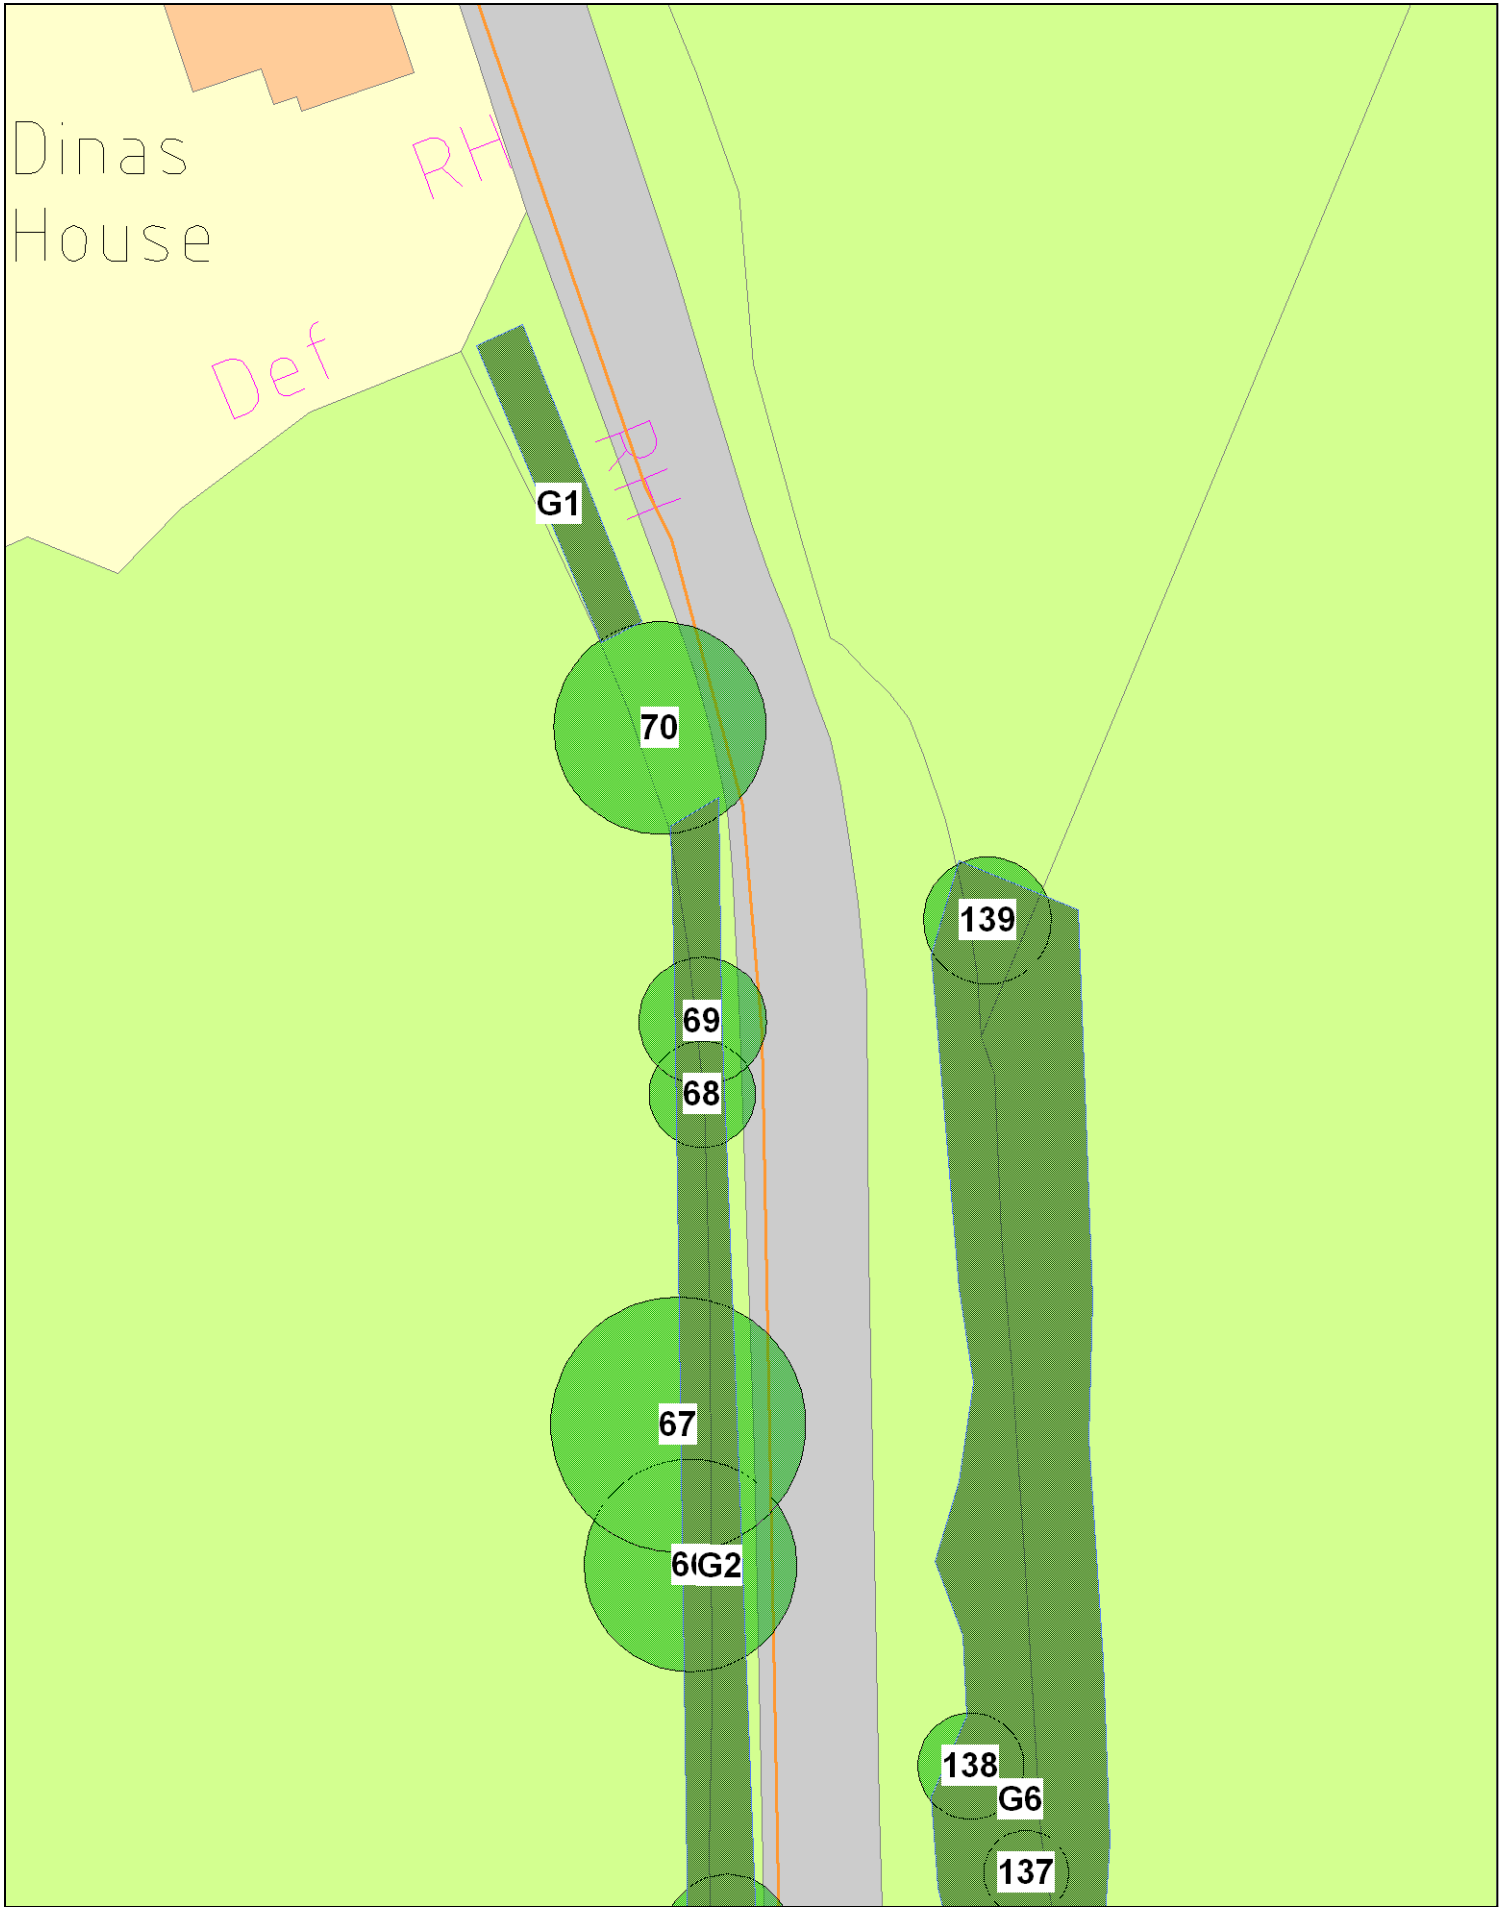


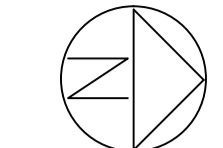

LEGEND

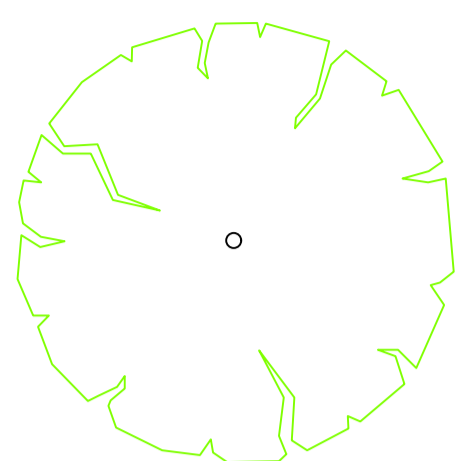

Trees – as surveyed

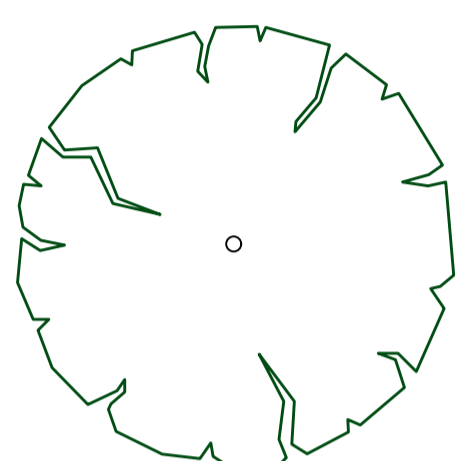

Trees – not surveyed, approximate location only shown




Stumps – not surveyed, approximate location only shown (numbers shown in brackets relate to numbers shown on Tree Survey plot where these differ from that shown on schedule)



NOTES

1. Topographical Survey details are based on Merrett Survey Drawing No. PB1898/01 dated 23 Jun 2014
2. Tree details are based on Arboricultural Survey carried out by DCC Arboricultural Officer
3. This drawing should be read in conjunction with Tree Survey Dinah's Hollow II - Dinah's Hollow survey dated 14 Jul 2014
4. Stump 0.02 and one tree in the vicinity of tree No. 108 and No. 109 could not be identified

orig	03July14	original	SA
Rev	Date	Issue / Remarks	Checked
 Dorset County Council ENVIRONMENT AND THE ECONOMY DIRECTORATE Mike Harries Director for Environment and the Economy			
DORSET HIGHWAYS Andrew Martin Head of Dorset Highways			
Project Title		Dinahs Hollow	
Drawing Title		Tree Survey	
Scale (A1 Size)	Drawn By	Date	
1:250	SA/TIM	31July14	
Drawing Number	Sheet Number		
BS4958/600/01/Orig			
Drawing Status			